

STATE OF VERMONT – DEPT. OF ENVIRONMENTAL CONSERVATION

Drinking Water & Groundwater Protection Division (DWGPD), 1 National Life Drive, Main Building – 2nd Floor,
Montpelier, VT 05620-3251

Tel. (802) 828-1535 or (802) 585-4907

WELL COMPLETION REPORT

WELL LOCATION

Well Owner or Purchaser: Richard Morgan
E-911 Address: 901 Rocky Lane

WELL TAG No. 48930

Town: Bennington
Subdivision Name: Rock Lane
Lot Number: _____

GEOGRAPHIC LOCATION (Complete A OR B, but not both)

Date Well Drilled: 6-18-2013

A. GPS Location: 42°55'37.5" N 72°55'37.5" W 07301146.4 7
Latitude Rdg. Longitude Rdg. GPS Make/Model # of Satellites Used (Min. 3)

B. Attach Town Map with well location marked, if not providing GPS location.

WELL TYPE (Check one)


- ☒ Bedrock
☐ Gravel
☐ Monitoring
☐ Other: _____

WELL USE (Check one)

- ☒ Residential/Non-public
☐ Public water system
☐ Agricultural
☐ Industrial
☐ Other: _____

REASON FOR WELL (Check one)

- ☒ New supply
☐ Replace existing supply
☐ Deepen existing supply
☐ Additional supply
☐ Test/exploration
☐ Geothermal
☐ Other: _____

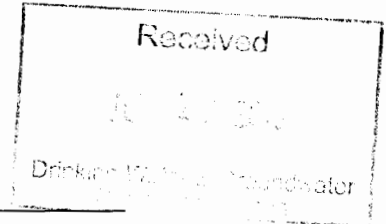

WELL CONSTRUCTION INFORMATION

DEPTHS

To bedrock
20 ft.
Total
260 ft

CASING

Total Length 80 ft.
Casing exposed 20 in.
Diameter 6 in.
Material Steel
Weight 17 lb/ft

LINER OR INNER CASING

Total Length 240 ft.
Depth to liner top 20 ft.
Diameter 4 in.
Material PVC
Weight 40 lb/ft
Seal type None
Bottom 3 slo Hcd

SCREEN DETAILS

Make/Type _____
Material _____
Diameter _____ in
Depth to screen top _____
Slot size _____
Gravel pack (type/size) _____

WELL LOG

From	To	Formation and water-bearing fracture Information
<u>0</u>	<u>20</u>	<u>T-TPH & Loose Gravel</u>
<u>20</u>	<u>80</u>	<u>R- Broken Quartz Bedrock</u>
<u>80</u>	<u>260</u>	<u>R- Broken Quartz Bedrock</u>
		<u>Water fracture at 235</u>
		<u>250-255 very chunky</u>

SEALING METHOD

- ☒ Drive Shoe
☐ Grouted – Grout type

YIELD TEST

Tested for 1 hr @ 45 GPM
Static Water Level 235 ft.
(below land surface)
☐ Overflowing? (check if yes)
☐ Hydrofractured? _____ GPM

WELL DRILLER INFORMATION

☒ Yes ☐ No; I provided property owner the Dept. of Health information, per 10 V.S.A. Section 1396(d)

Drilled by: Jody Townsend

Signature of Qualifying Individual
Company: Frostwells & Pumps
Lic # 23

COMMENTS AND SITE SKETCH

Installed 4" PVC to Bottom of well
to stabilize well Bottom 3 are slo Hcd
Set pump at 245

White Copy - DWGPD

Yellow Copy - Owner

Pink Copy - Driller

1/10/13